## Firmware update

The firmware for the following products has been updated. KW-DB60ED,KW-DB60ATED,KW-DB60ATEND, KW-DB70ATAD

 
This update improves the reception of DAB tuner.

## Preparation:

- 1. Download the Firmware update file "J12M569\_V111.zip" and save it on your desktop.
- 2. Unzip it on to your desktop. In the unzipped folder, you will see the file "J12M569.rom".
- 3. Copy the file onto a USB flash drive. Do not save into any folder.

## **Update Procedure:**

- 4. Press the "SOURCE" key and select to "DAB" in the unit.
- 5. Press and hold "MENU" key almost 2 seconds.



6. TURN the "VOL" knob and select to "TUNER". Press the "VOL" knob.



 
7. Turn the "VOL" knob and select to firmware version.

A firmware version will be appeared on the display as shown below.

Press and hold the "VOL" knob almost 2 seconds.



8. Insert the USB flash drive into the car-radio's USB port.



READING

Start updating automatically.

UPDATING ##

- 9. It takes almost 20 minutes to update. Do not turn off power during the update.
- 10. "COMPLETED" message will be displayed when finished.

**COMPLETE** 

- 11. The receiver will be reset automatically.
  - If "COMPLETE" is still displayed even after 1 minute, please perform following steps.
  - 1. Press the RESET button.
  - 2. Refer to the Setp7 to confirm the firmware version.
- 12. Remove the USB flash drive.